Cover images

Flood of September 2008 in Northwestern Indiana

OPEN-FILE REPORT 2010–1098

U.S. Department of the Interior
U.S. Geological Survey

Conversion Factors, Datums, Abbreviations, and Acronyms

Multiply	By	To obtain
inch (in.)	2.54	centimeter (cm)
inch (in.)	25.4	millimeter (mm)
foot (ft)	0.3048	meter (m)
mile (mi)	1.609	kilometer (km)
acre	4,047	square meter (m^2)
acre	0.4047	hectare (ha)
cubic foot (ft^3)	28.32	cubic decimeter (dm^3)
cubic foot (ft^3)	0.02832	cubic meter (m^3)
cubic foot per second (ft^3/s)	0.02832	cubic meter per second (m^3/s)
inch per hour (in/h)	0.0254	meter per hour (m/h)

Flood of September 2008 in Northwestern Indiana

Abstract

During September 12–15, 2008, rainfall ranging from 2 to more than 11 inches fell on northwestern Indiana. The rainfall resulted in extensive flooding on many streams within the Lake Michigan and Kankakee River Basins during September 12–18, causing two deaths, evacuation of hundreds of residents, and millions of dollars of damage to residences, businesses, and infrastructure. In all, six counties in northwestern Indiana were declared Federal disaster areas.

U.S. Geological Survey (USGS) streamgages at four locations recorded new record peak streamflows as a result of the heavy rainfall. Peak-gage-height data, peak-streamflow data, annual exceedance probabilities, and recurrence intervals are tabulated in this report for 10 USGS streamgages in northwestern Indiana. Recurrence intervals of flood-peak streamflows were estimated to be greater than 100 years at six streamgages. Because flooding was particularly severe in the communities of Munster, Dyer, Hammond, Highland, Gary, Lake Station, Hobart, Schererville, Merrillville, Michiana Shores, and Portage, high-water-mark data collected after the flood were tabulated for those communities. Flood peak inundation maps and water-surface profiles for selected streams were made in a geographic information system by combining

Collection of High-Water-Mark Data

High-water marks were identified and flagged in the field by IDNR and USGS field crews after floodwaters receded. High-water marks were set along approximately 46 miles of streams after the floods. For this study, high-water marks were

Estimation of Annual Exceedance Probabilities

Annual exceedance probabilities (the reciprocal of the recurrence intervals) associated with the peak streamfows for 10 active streamgages (table 2) were estimated to indicate the relative magnitude of the September 2008 fooding. Annual exceedance probabilities were obtained from "coordinated" discharge-frequency curves available in the IDNR online publication "Coordinated Discharges of Selected Streams in Indiana" (*http://www.in.gov/dnr/water/4898.htm*). The methods used to produce the food discharge-frequency curves are outlined in Bulletin 17B, the "Guidelines for Determining Flood Flow Frequency" (U.S. Interagency Advisory Committee on Water Data, 1982). The coordinated discharge-frequency curves were established and are maintained according to a Memorandum of Understanding dated May 6, 1976, that was signed by the U.S. Department of Agriculture, Soil Conservation Service (now the Natural Resources Conservation Service), the USGS, the U.S. Army Corps of Engineers, and the IDNR. These agencies agreed to coordinate discharge-frequency values for use in water-resources investigations and planning activities in Indiana.

Estimated Magnitudes and Annual Exceedance Probabilities of Peak Streamflows for the Flood of September 2008

Peak-gage-height data, peak-streamfow data, and estimated annual exceedance probabilities from the September food for 10 USGS streamgages in northwestern Indiana are listed in table 2, and streamgage locations are shown in fgure 4. New streamfow peaks of record wewe ltew â

Description of Flood Damages and Impacts

Record fooding, power outages, and evacuations affected thousands of northwestern Indiana residents during September 2008 and caused millions of dollars worth of damage to homes, businesses, and infrastructure. Areas of fooding were extensive in the communities of Munster, Dyer, Hobart, Portage, and Michiana Shores as local streams and ditches rose rapidly during September 12–15, 2008. Hart Ditch at Dyer and Hart Ditch at Munster both peaked on September 14 at stages and **discharges** that exceeded the previous records. Trail Creek at Michigan City and Little Calumet River at Munster also peaked on September 14, both at record stage. Little Calumet River at Porter, Deep River at Lake George Outlet, and the Kankakee River at Davis continued rising and peaked the following day, September 15. Both Deep River and the Little Calumet River (at Porter) exceeded previous record stage and discharge. Stream reaches further downstream on the Kankakee River peaked from September 17 to 19.

The following is a summary of food impacts compiled after September 2008:

- The fooding caused two fatalities and numerous injuries.
- More than 5,000 evacuations and water rescues were made during the fooding (Shipe, 2008).
- About 180 Indiana National Guard Soldiers and Airmen supported relief missions during fooding in northern Indiana.
- Food and drinking-water distribution points were set up in the affected counties.
- Levee breaches occurred in Lake and Newton Counties.
- Main electric transmission lines were damaged.
- Emergency Services Radio Towers were damaged by wind.
- Transportation disruptions were widespread. A 40-mile stretch of Interstate 65 was closed for 2 days (Midwest Regional Climate Center, 2008).
- Runoff from tributaries carried massive amounts of sediment into Lake Michigan, contaminating the water,

References Cited

American Society of Civil Engineers, 1953, Report of the subcommittee on the joint division committee on floods: American Society of Civil Engineers Transactions, v. 118, p.1220–1230.

Bonnin, G.M.; Martin, Deborah; Lin, Bingzhang; Parzybok, Tye; Yekta, Michael; and Riley, David, 2006, Precipitation-frequency atlas of the United States: National Oceanic and Atmospheric Administration Atlas 14, v. 2, ver. 3.0 [variously paged], accessed April 5, 2010, at *http://www.weather.gov/oh/hdsc/PF_documents/Atlas14_Volume2.pdf*.

Federal Emergency Management Agency, 2008a, 2008 Federal disaster declarations: Accessed March 29, 2010, at *http://www.fema.gov/news/disasters.fema*.

Federal Emergency Management Agency, 2008b, HAZUS: Accessed October 7, 2008, at *http://www.fema.gov/plan/prevent/hazus/*.

Federal Emergency Management Agency, 2008c, Federal Assistance for Indiana for Hurricane Ike tops $78 million: Accessed April 2, 2010, at *http://www.fema.gov/news/newsrelease.fema?id=47493*.

Hodgkins, G.A., Stewart, G.J., Cohn, T.A., and Dudley, R.W., 2007, Estimated magnitudes and recurrence intervals of peak flows on the Mousam and Little Ossipee Rivers for the flood of April 2007 in southern Maine: U.S. Geological Survey Open-File Report 2007–1146, 5 p., accessed August 12, 2009, at *http://pubs.usgs.gov/of/2007/1146/*.

Glossary

The following definitions, except where noted, are from Langbein and Iseri (1960).

annual exceedance probability The probability that a given event magnitude will be exceeded or equaled in any given year. For example, the annual exceedance probability of the 100-year peak flood streamflow is 0.01. In other words, there is a 1-percent chance that the 100-year peak flow will be exceeded or equaled in any given year.

cold front A zone separating two air masses, of which the cooler, denser mass is advancing and replacing the warmer (National Weather Service, 2005).

cubic feet per second A unit expressing rates of discharge. One cubic foot per second is equal to the discharge of a stream of rectangular cross section, 1 foot wide and 1 foot deep, flowing water an average velocity of 1 foot per second.

flood peak The highest value of the stage or discharge attained by a flood; thus, peak stage or peak discharge. "Flood crest" has nearly the same meaning, but since it connotes the top of the flood wave, it is properly used only in referring to stage—thus, "crest stage," but not "crest discharge."

flood plain A strip of relatively smooth land bordering a stream, built of sediment carried by the stream and dropped in the slack water beyond the influence of the swiftest current. It is called a living flood plain if it is overflowed in times of highwater, but a fossil flood plain if it is beyond the reach of the highest flood.

flood profile A graph of elevation of the water surface of a river in flood, plotted as ordinate, against distance, measured in the downstream direction, plotted as abscissa. A flood profile may be drawn to show elevation at a given time or crests during a particular flood.

gage height The water-surface elevation referred to some arbitrary gage datum. Gage height is often used interchangeably with the more general term "stage," although gage height is more appropriate when used with a reading on a gage.

recurrence interval (return period) The average interval of time within which the given flood will be equaled or exceeded once.

stream A general term for a body of flowing water. In hydrology the term is generally applied to the water flowing in a natural channel as distinct from a canal.

streamflow The discharge that occurs in a natural channel. Although the term "discharge" can be applied to the flow of a canal, the word "streamflow" uniquely describes the discharge in a surface stream course.

streamgage A gaging station where a record of discharge of a stream is obtained. Within the U.S. Geological Survey this term is used only for those gaging stations where a continuous record of gage-height is obtained.

Appendix 1. Site Descriptions and High-Water Marks at Study Sites, Flood of September 2008, Indiana.

[Vertical coordinate data are referenced to the North American Vertical Datum of 1988 (NAVD 88). Horizontal coordinate data are referenced to the North American Datum of 1983. Approximate quantitative indications of accuracy of high-water-mark ratings: Excellent, ± 0.02 foot; Good, ± 0.05 foot; Fair, ± 0.10 foot; and Poor, > 0.10 foot (Lumia and others ,1986); for bank of nearest watercourse, “right” and “left” refer to an observation looking in the downstream direction of the watercourse. RM, reference mark]

Community name	Elevation (feet above NAVD 88)	Latitude	Longitude	High-water-mark description	High-water-mark rating	Nearest watercourse	Bank of nearest watercourse
Dyer	655.61	41° 28′ 17.9″	87° 30′ 12.7″	Seed line on maple tree	Good	Dyer Ditch	Left
Dyer	657.00	41° 28′ 18.6″	87° 30′ 12.4″	Seed line on maple tree	Good	Dyer Ditch	Left
Dyer	653.69	41° 28′ 19.3″	87° 30′ 12.2″	Seed line on hickory tree	Good	Dyer Ditch	Left
Dyer	652.98	41° 28′ 19.6″	87° 30′ 12.1″	Drift line on willow tree	Good	Dyer Ditch	Left
Dyer	638.78	41° 28′ 43.8″	87° 30′ 11.8″	Mud line on willow tree	Good	Dyer Ditch	Right
Dyer	638.68	41° 28′ 45.1″	87° 30′ 11.5″	Drift line on elm tree	Good	Dyer Ditch	Left
Dyer	639.26	41° 28′ 45.7″	87° 30′ 11.4″	Seed line on willow tree	Good	Dyer Ditch	Left
Dyer	629.64	41° 29′ 27.6″	87° 29′ 28.2″	Mud line on maple tree	Good	Dyer Ditch	Right
Dyer	629.69	41° 29′ 28.0″	87° 29′ 22.2″	Mud line on catalpa tree	Good	Dyer Ditch	Right

q 1 0 0 1 72 72 cm /Span <</MCID 1215 >>BDC BT /F4 9 Tf 1 0 0 1 504.04B>Tj ET EMC /Span <</MCID 1215 >>55T /C2_0 1 0 1 Tf 9 0

[Vertical coordinate data are North American Datum of 1983. A , Fair, ± 0.10 foot; and Poor, > 0.10 the down-stream direction of the wate

Community name	Elevatio (feet above NAVD 88)		st course	Bank of nearest water-course
Gary	598.97	41° 34′ 15.		

[Vertical coordinate data are referenced to the North American Vertical Datum of 1988 (NAVD 88). Horizontal coordinate data are referenced to the North American Datum of 1983. Approximate quantitative indications of accuracy of high-water-mark ratings: Excellent, ± 0.02 foot; Good, ± 0.05 foot; Fair, ± 0.10 foot; and Poor, > 0.10 foot (Lumia and others ,1986); for bank of nearest watercourse, "right" and "left" refer to an observation looking in the downstream direction of the watercourse. RM, reference mark]

Community name	Elevation (feet above NAVD 88)	Latitude	Longitude	High-water-mark description	High-water-mark rating	Nearest watercourse	Bank of nearest watercourse
Michiana Shores	601.94	41° 45′ 33.0 ⌋	86° 48′ 49.7 ⌋	Drift line on mulberry tree	Poor	White Ditch	Left
Michiana Shores	601.68	41° 45′ 33.3 ⌋	86° 48′ 48.9 ⌋	Mud line on cherry tree	Poor	White Ditch	Left
Michiana Shores	600.21	41° 45′ 36.3 ⌋	86° 48′ 38.5 ⌋	Mud line on silver maple tree	Fair	White Ditch	Right
Michiana Shores	600.24	41° 45′ 36.2 ⌋	86° 48′ 39.0 ⌋	Mud line on elm tree	Fair	White Ditch	Right
Munster	598.87	41° 34′ 15.7 ⌋	87° 30′ 31.6 ⌋	Mud/Seed line on elm tree	Good	Little Calumet	Left
Munster	598.57	41° 34′ 15.8 ⌋	87° 30′ 34.4 ⌋	Mud/Seed line on utility pole	Good	Little Calumet	Left
Munster	598.17	41° 34′ 29.9 ⌋	87° 31′ 10.3 ⌋				

Appendix 2. Flood-Peak Inundation Maps for Selected Study Streams and Communities, Flood of September 2008, Indiana.

http://pubs.usgs.gov/ofr/2010/1098/
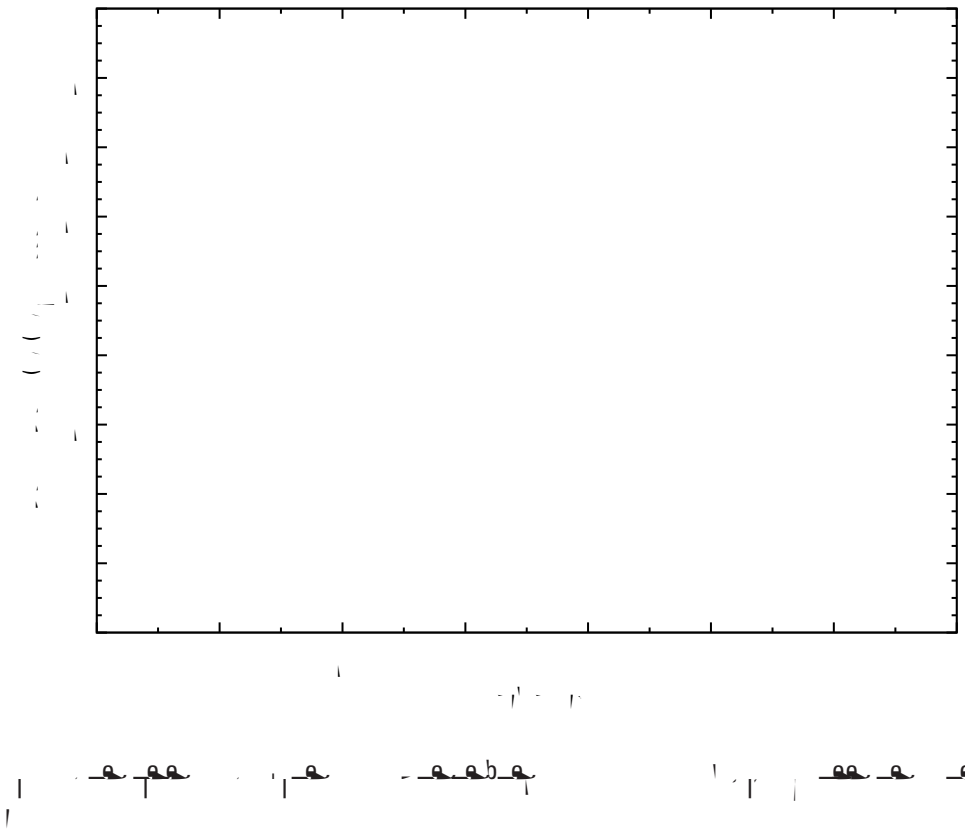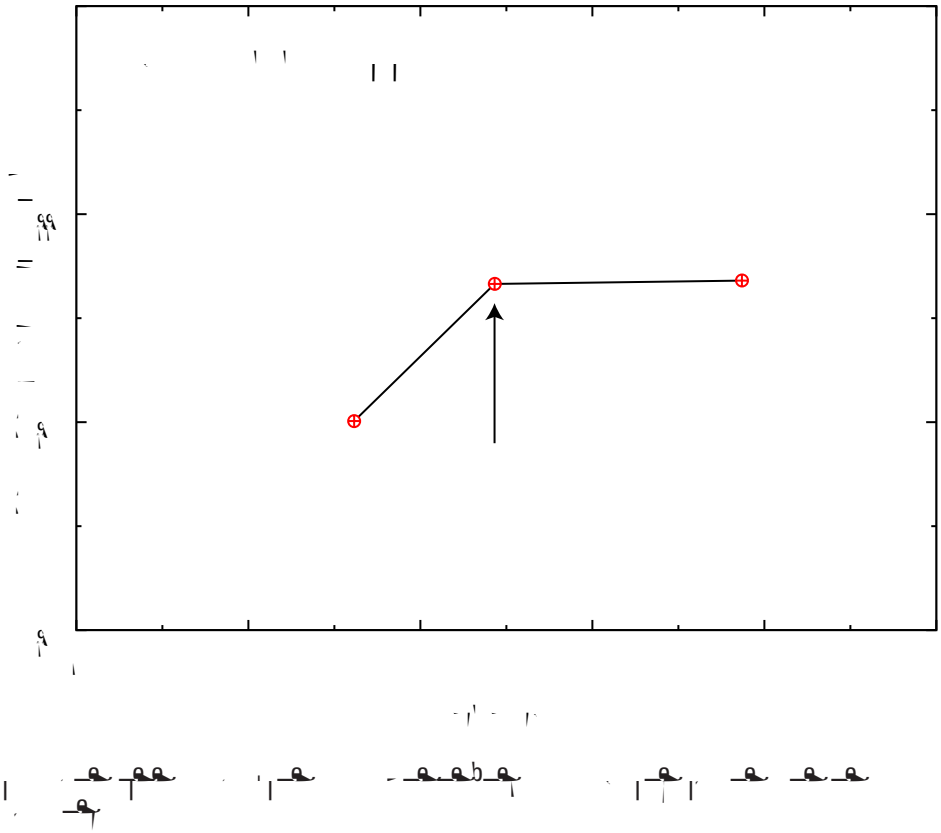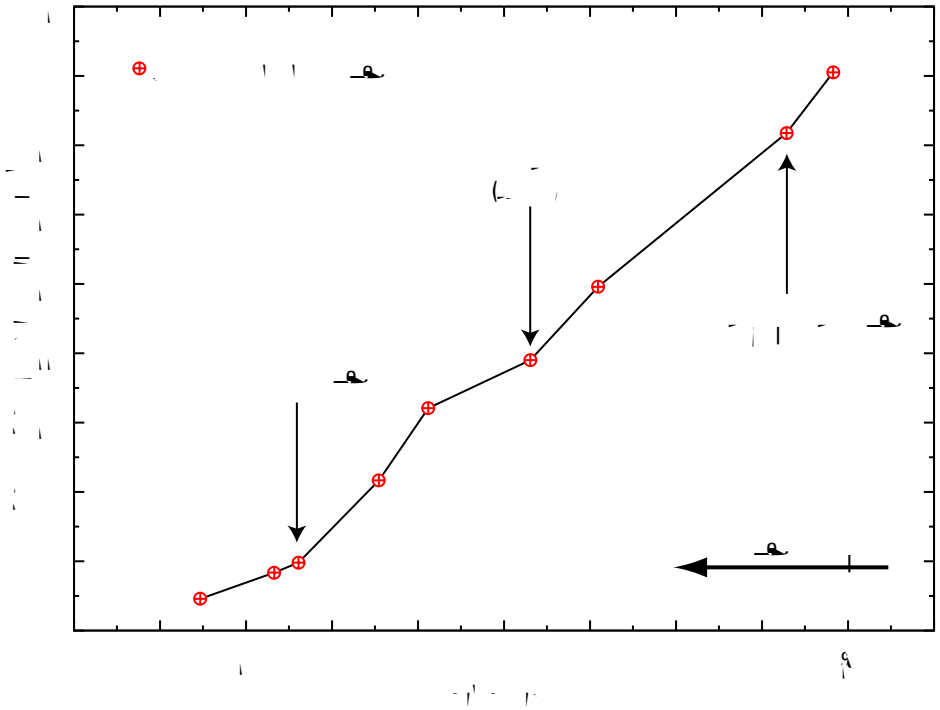
Appendix 3. Flood-Peak Elevation Profiles for Selected Sites, Flood of September 2008, Indiana